 



Helibar as CS05 cross stitch with dry fix where they can not be lapped by 500mm, Cemtie No 4 fracture from the West elevation at 300c/c.

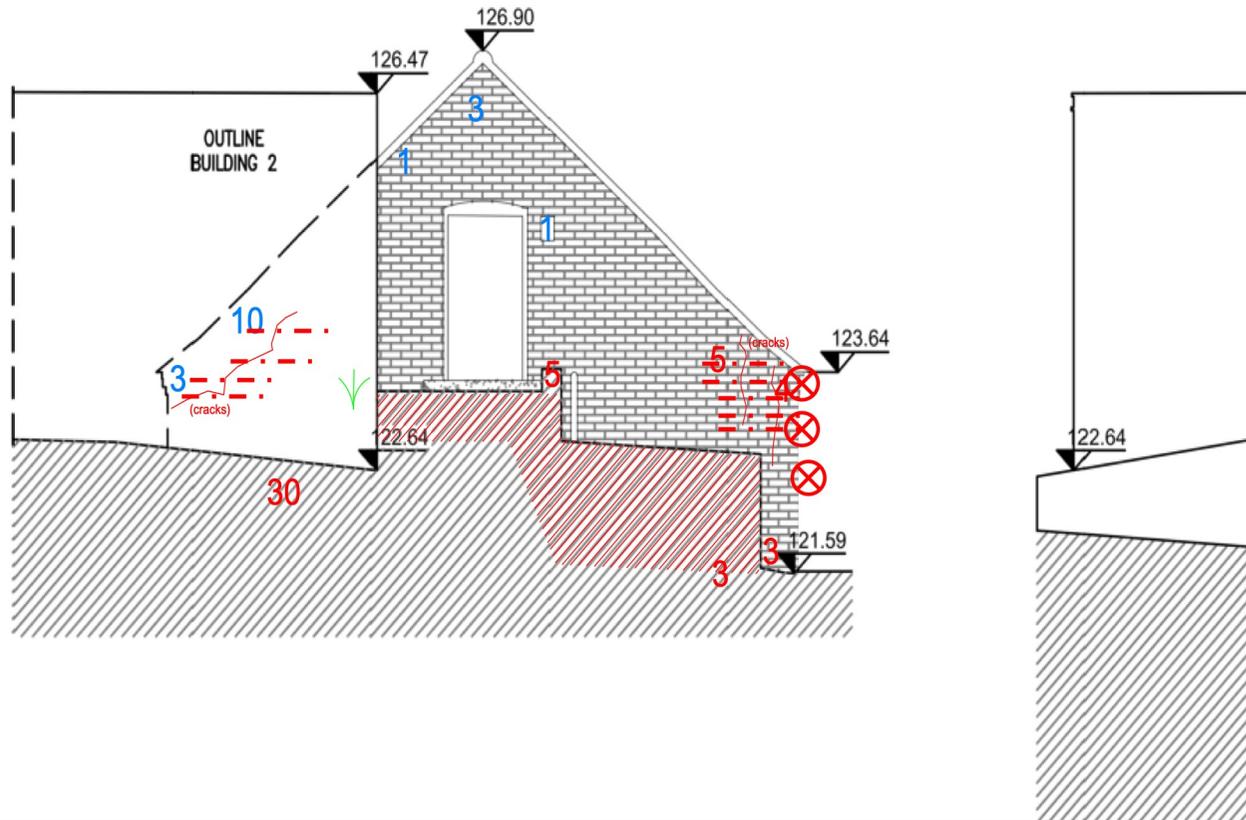

Bulbourne Yard - Building 3, North Elevation
Investigation of façade masonry
30 November 2019

Hutton + Rostron Environmental Investigations Ltd
Netley House, Gomshall, Surrey, GU5 9QA Tel: 01483 203221 Fax: 01483 202911
150.90 Site Note 3 -Not to scale- © Copyright Hutton+Rostron 2019

- Key:**
- 2 Damaged/heavily eroded brick (to be made good)
 - 2 Redundant fixings/services (to be removed and brickwork made good)
 - Vegetation (to be cut out and brickwork made good)
 - Particular area of pointing failure (minimum requirement for re-pointing)
 - e Structural defect (for comment by SE)
 - Approximate location of crack (for comment by SE, allow for re-pointing and possible strengthening)

Date:
29.2.20

By:
Dennis Hunt